

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 11

Township: 9 North


Range: 1 East

Corner ID: BenSo Q-09

Monument Description & Remarks: Sandstone with "X", length 0.85ft, width 0.42ft, height 0.60ft. Survey Sign 4.5ft above ground at pt. B

References On File: Legal Survey Book 2, page 50 (1861); Darrell Breedlove, Forest Recovery Tie (1983); Michael Friley, M.C.S. Monument Record (1995), on file in Surveyor Office


RECOVERY TIE DRAWING
Field Book 41 Page No. 57

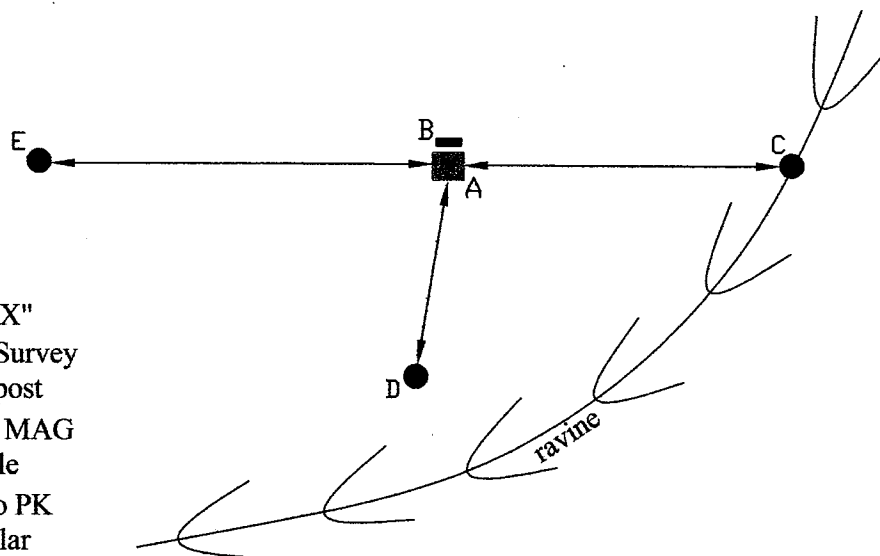

- A - Sandstone with "X"
- B - N 04° E 0.85' to Survey Sign on metal fence post
- C - S 88° E 44.40' to MAG nail in 6" Sugar Maple
- D - S 23° W 13.94' to PK nail in 14" Tulip Poplar
- E - N 87° W 35.13' to MAG nail in 5" Beech Tree

Not To Scale
Compass Bearing Magnetic North

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 29th day of September, 2008.

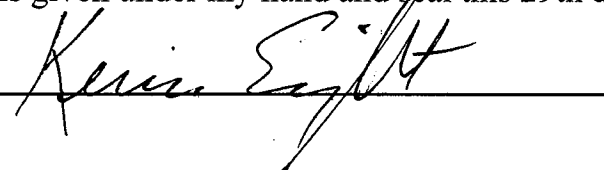



Administered by the Monroe County Surveyor Review Board

Date: 1-13-2009

MONUMENT RECORD

Corner I.D. #


Q-9

STATE OF INDIANA - COUNTY OF MONROE

Section Fifteen (15), Township 9 North, Range 1 East

Monument Description & Remarks: Stone w/"X" found at NE corner of section.

Stone leans west. Steel fence post driven next to stone. Corner witnessed
5/30/88. See attached notes.

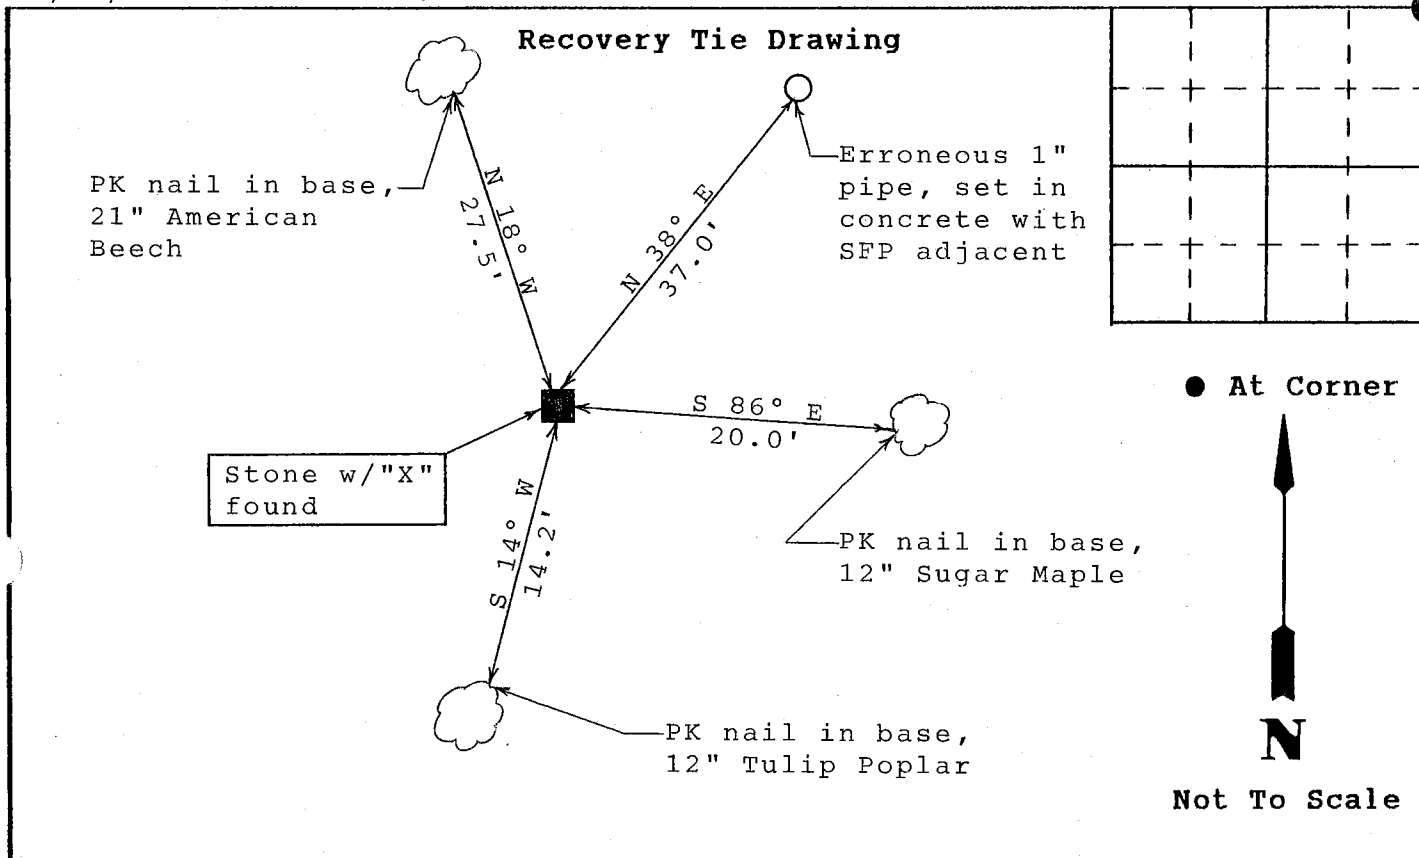

State of Indiana

County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; and the above data is given under my hand and seal this 8th day of February, 1995 A.D.

Space
Reserved For
Recording
Officer

Indiana Registered Land Surveyor No. _____ or

Morgan-Monroe State Forest
United States Government Agency

Darrell Breedlove, Timber Specialist
Title

Field Book:

n/a

Page:

n/a

SECTION 15, T 9 N, R 1 E

1. On July 18, 1983, boundary line location and marking was completed for the NE $\frac{1}{4}$, NE $\frac{1}{4}$, SEC 15. The line was painted on the state side with orange tree marking paint, and signs were posted at all corners except SW, where an encroachment problem may exist (report made). The following corner markers were found: SE-stone (needs to be witnessed), ~~NE pipe~~, ~~NW pipe~~. No corner marker or other clear evidence was found to establish the SW corner.

Darrell Breedlove

Darrell Breedlove, Timber Specialist

- 2a. On May 30, 1988, the NE corner stone of sec.15 was witnessed as follows:

<u>Az</u>	<u>Species</u>	<u>DBH(in.)</u>	<u>Distance (Ft.)</u>	
094	Sugar Maple	12	20.0	S 86° E
194	Tulip Poplar	12	14.2	S 14° W
342	Am. Beech	21	27.5	N 18° W

Pk nails were driven at the base of witness trees. This stone has an "X", and it leans west.

An erroneous 1 in. pipe, set in concrete with a steel fence post next to it, is Az 038 and 37.0 ft. from the stone.

- b. On August 17, 1988, a fence post was driven next to the NE corner stone of Sec. 15.

Darrell Breedlove
Darrell Breedlove,
Timber Specialist

3. On August 17, 1988, the SE corner, NE $\frac{1}{4}$, NE $\frac{1}{4}$, Sec.15, T9N, R1E was witnessed as follows:

<u>Az</u>	<u>Species</u>	<u>DBH (in.)</u>	<u>Distance (Ft.)</u>	<u>Comments</u>
232	Tulip Poplar	12	13.5	Hollow
120	Shagbark Hickory	12	18.0	
017	Sassafras	2	10.2	W/plastic sign

Galvanized nails were driven at the base of witness trees. This stone has an "X" and it leans west. It is bearing S1.6° E (1° W declin.) from a stone found at the NE corner, Sec. 15.

Darrell Breedlove
Darrell Breedlove
Timber Specialist



Ben So Q-09

09/29/2008